

Recommended Service on Meter Pole

This is to be used only as an illustration.


All Wiring should be in accordance with National Electric Code.

Meter Base - Made Available by Parke County REMC

Disconnect Box - Provided by Customer

Installed - by Wireman

1. Pole - 30' Class 5 pole
2. Apply Aluminum Electrical Joint compound to all conductors BEFORE installing in terminals.
3. For a 200 amp box run 3/0 copper or 4/0 aluminum in 2" Ridgid conduit or PVC Sch 80. Neutral may be reduced to 2/0.
4. For a 100 amp box run #2 copper or #2 aluminum in 1-1/4" Ridgid conduit or PVC Sch 80. Neutral may be reduced to #4.
5. **Ground the Breaker Box** Not the Meter base.
(200 Amp - #4 Bare Copper ground wire)
(100 Amp - #6 Bare Copper ground wire)
6. Install 5/8" x 8' Ground Rod.
7. RHW or THW insulation is recommended.
8. Weather Proof Bushing and Locknuts at all box connections.

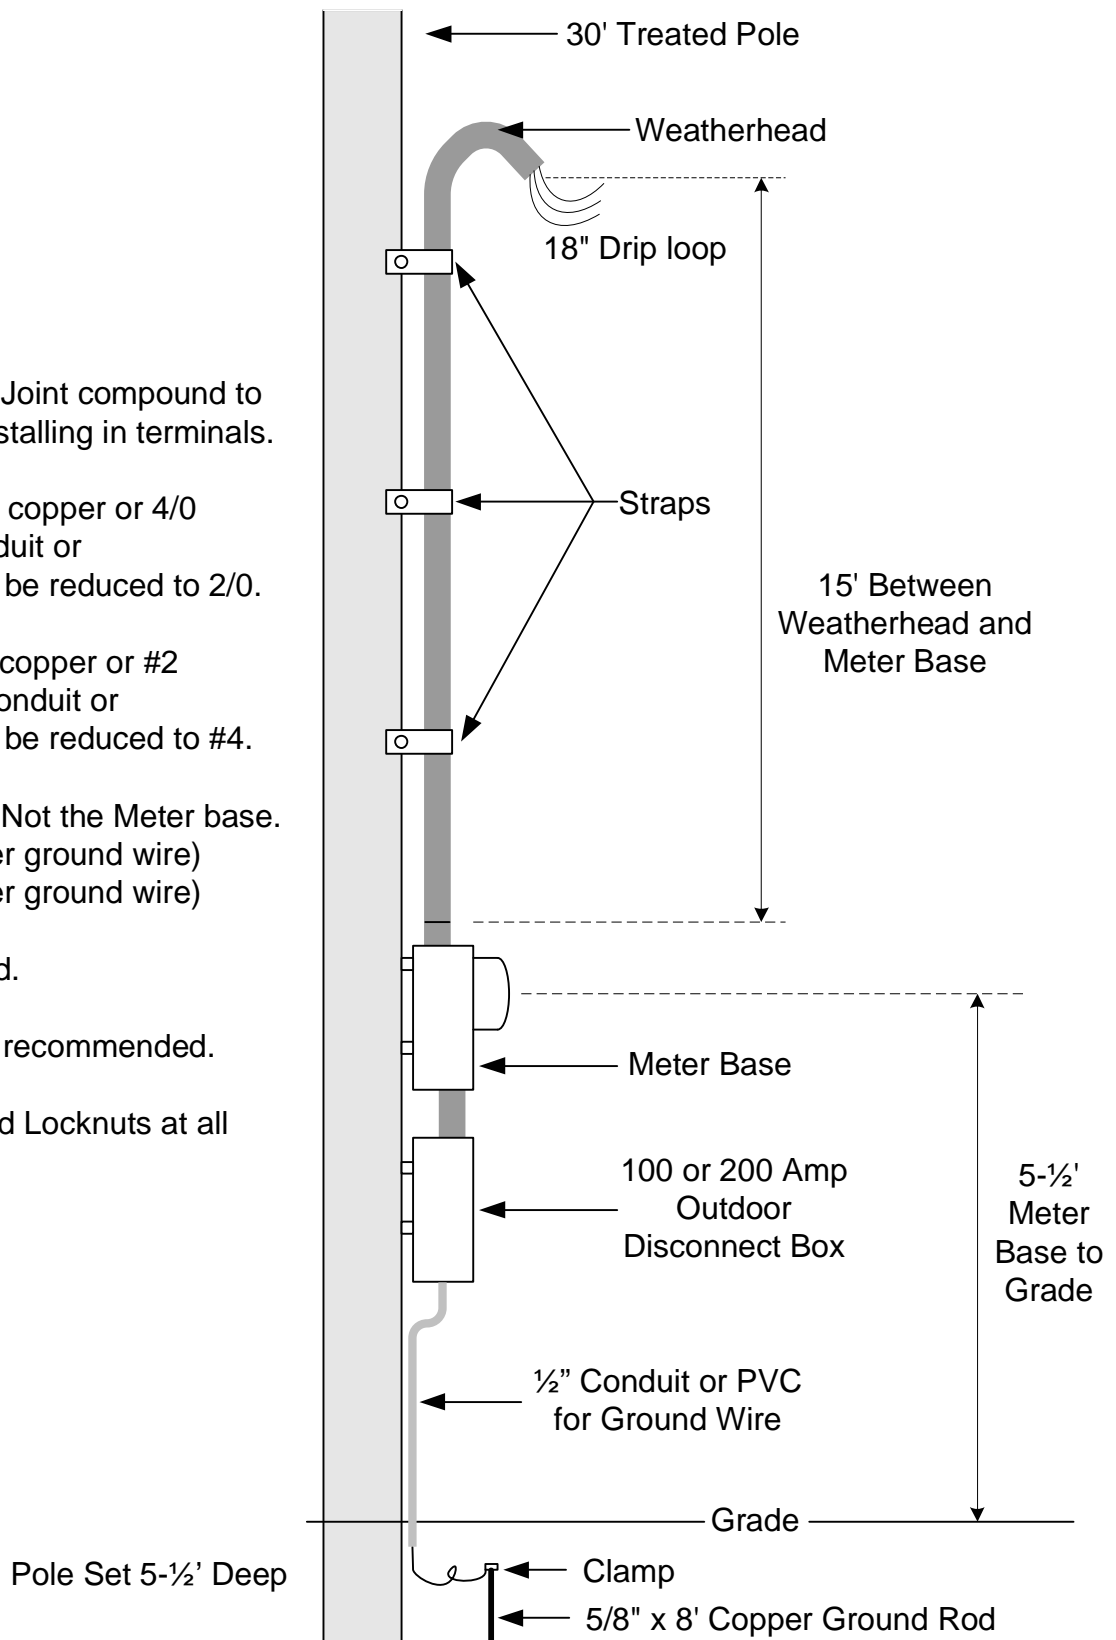

Gene Baxter - Staking Coordinator

Parke County Rural Electric Membership Corporation

119 W. High Street, Rockville, IN 47872-1735

Telephone: (765) 569-3133 (800) 537-3913 Fax: (765) 569-3360

E-mail: gbaxter@pcremc.com Web Page: pcremc.com

Revised 01/07/09